

Montagehinweise

für Motoranbau an Planetengetriebe PA / PHA über
Motoradapter mit Belüftung MFC, MFLC

de

ID 441940.07

Seite 1 von 2



Kieselbronner Straße 12 • 75177 Pforzheim
Postfach 910103 • 75091 Pforzheim
Phone +49 7231 582-0 • Fax +49 7231 582-1000
eMail: mail@stoeber.de • Internet: http://www.stoeber.de

1. Allgemeine Hinweise

Mit belüftetem Planetengetriebe - im Motoradapter - lassen sich die Betriebstemperaturen der Getriebe senken oder es können, bei gleicher Betriebstemperatur, die im ServoFit® Katalog, ID 442257, ausgewiesenen zulässigen Eintriebsdrehzahlen für Dauerbetrieb ($n_1 \text{ MAX DB}$) erhöht werden. Nähere Angaben hierzu, siehe Katalog ServoCool, ID 441851.

Der Anbau von Servomotoren erfolgt kraftschlüssig über eine Klemmkupplung, der Lüfter wird nach der Montage des Motors auf der Motorwelle, bei kleinen Motorwellendurchmessern auf der Adapterwelle, befestigt.

Die Kupplung arbeitet absolut spielfrei und bedarf keiner Wartung. Die Motoren haben eine glatte Welle (ohne Passfeder). Die normale Rundlauf-, Planlauf und Koaxialitätsgüte nach DIN 42955 - N für Wellenende und Befestigungsflansch ist ausreichend.

Maßtoleranzen: Der Zentrierdurchmesser am Motorflansch muss ISO j6, die Motorwelle ISO k6 sein.

2. Lüftermontage bei nachträglichem Einbau

- Sofern der Passrand-Durchmesser des Motors kleiner als der Durchmesser des Lüfterflügels ist, Befestigungsschrauben 3.10.020 lösen und Motoranschlussflansch 3.10.010 entfernen und nach der Lüftermontage (siehe Abschnitt 2.1 bzw. 2.2) wieder montieren. Anziehdrehmomente M_A für Schrauben 3.10.020 siehe Tabelle.

2.1 Lüftermontage für Getriebe ohne Adapterwelle (Bild 1)

- Motorwelle mit fettlösendem Mittel sorgfältig **entfetten**.
- Klemmbuchse (3.40.030) in Lüfter (3.40.020) einschieben und auf Zentrierbuchse (3.40.090) aufschieben.

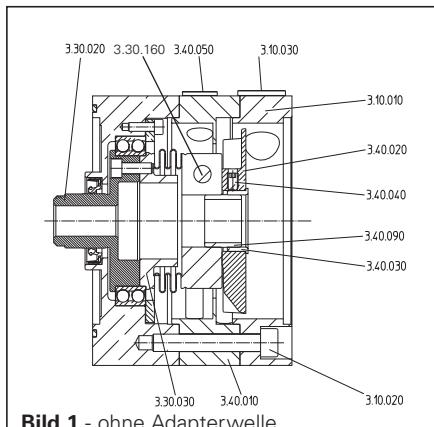


Bild 1 - ohne Adapterwelle

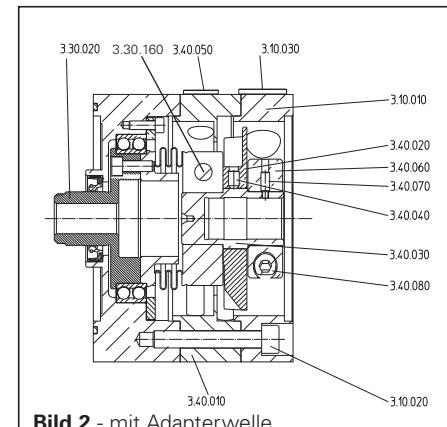


Bild 2 - mit Adapterwelle

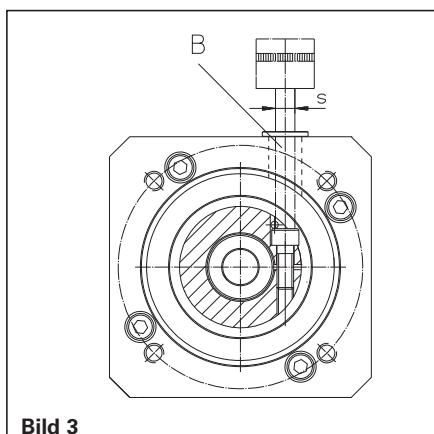


Bild 3

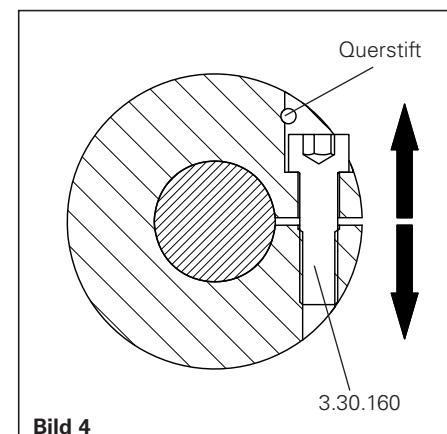


Bild 4

Anziehdrehmomente M_A

| Getriebe | Klemmschraube/ Befestigungs- schraube Positions-Nr. | Gewinde | Schlüssel- weite "s" (mm) | Anzieh- moment M_A (Nm) |
|--|--|------------------------|---------------------------------|------------------------------------|
| PA321MFLC, PHA321MFLC, PA421MFC, PHA421MFC , PA422MFLC, PHA422MFLC, PA522 MFC, PHA522MFC | 3.30.160 3.40.040 3.40.080 3.10.020 | M6 M4 M5 M6 | 5 2 4 5 | 16 1,5 6 10 |
| PA421MFLC, PHA421MFLC, PA521MFC, PHA521MFC, PA522MFLC, PHA522MFLC, PA722MFC, PHA722MFC | 3.30.160 3.40.040 3.40.080 3.10.020 | M8 M5 M6 M8 | 6 2,5 5 6 | 40 2 10 25 |
| PA521MFLC, PHA521MFLC, PA721MFC, PHA721MFC, PA722MFLC, PHA722MFLC, PA822MFC, PHA822MFC, PHA923MFC,PHVA933MFC | 3.30.160 3.40.040 3.40.080 3.10.020 | M10 M8 M8 M10 | 8 4 6 8 | 75 5 25 49 |
| PA721MFLC, PHA721MFLC, PA821MFC, PHA821MFC, PA822MFLC, PHA822MFLC, PHA912MFC, PHA932MFC, PHA1012MFC, PHA1023MFC, PHA1032MFC, PHVA1033MFC | 3.30.160 3.40.040 3.40.080 3.10.020 | M12 M8 M8 M12 | 10 4 6 10 | 130 5 25 85 |

ACHTUNG! Motorwelle dabei zentrisch in Zentrierbuchse (3.40.090) bzw. in Adapterwelle (3.40.030) einstecken. Nicht verkanten!
- Sofern Motorwelle nicht einführbar Klemmschraube (3.30.160) ca.eine viertel Umdrehung gegen Querstift aufdrehen, damit sich die Nabe weitet (siehe Bild 4).

- Motor am Adaptergehäuse festschrauben.
- Klemmschraube (3.30.160) bzw. bei Adapterwelle auch Klemmschraube (3.40.080) am Klemmring anziehen. Dazu Verlängerungsstück des Drehmomentschlüssels durch Montagebohrung (B) führen (Bild 3). Anziehdrehmoment M_A nachTabelle.
- Lüfterflügel auf Motorwelle bzw. Adapterwelle befestigen, dazu Verlängerungsstück des Drehmomentschlüssels durch den motorseitigen Lüftungsschlitz führen. 3 x Befestigungsschraube(3.40.040) gemäß Tabelle anziehen.
- Montagebohrung mit Kunststoffstopfen (3.40.050) bzw. (3.10.030) wieder verschließen.

Assembly instructions

for motor mounting to planetary gear units PA / PHA by motor adapter
with air cooling MFC, MFCL

en

ID 441940.07

Page 2 of 2
STÖBER ANTRIEBSTECHNIK
 Dieselbronner Straße 12 • 75177 Pforzheim
 Postfach 910103 • 75091 Pforzheim
 Phone +49 7231 582-0 • Fax +49 7231 582-1000
 eMail: mail@stoeber.de • Internet: http://www.stoeber.de

1. General Notes

With an air-cooled planetary gearing in the motor adapter, the operating temperatures of the gearing can be reduced or the gearing input speed specified in the catalogue, ID 442257 for constant operation (n_{1MAXDB}) can be increased at the same operating temperature. For more information on this, see catalogue ServoCool, ID 441851.

Servomotors are frictionally connected by a clamp coupling. The fan is attached on the motor shaft after the motor is installed. For small motor shaft diameter the fan is attached on the adapter shaft.

The coupling operates absolutely free of backlash and does not require any maintenance. The motors have a plain shaft (without key). Standard rotational accuracy, axial run-out and concentricity values to DIN 42955-N for shaft end and mounting flange of the motor suffices.

Dimensional tolerances: The centering diameter on the motor flange must be produced to tolerance ISO j6, the motor shaft to ISO k6.

2. Fan mounting by additional installation

- If the pilot diameter is smaller than the fan diameter, unscrew the cheese-head screw (3.10.020) remove motor connection flange (3.10.010). After the fan assembling (see chapter 2.1 and 2.2) assemble it again. Tightening torque M_A for screws (3.10.020) as per table.

2.1 Fan mounting for units without adapter shaft (Fig. 1)

- Carefully **degrease** motor shaft with grease solving agent.
 - Push clamping sleeve (3.40.030) in fan (3.40.020) and slide the fan onto the centering ring (3.40.090).

2.2 Fan mounting for units with adapter shaft (Fig. 2)

- Carefully **degrease** motor shaft with grease solving agent.
 - Push fan (3.40.020) onto the adapter shaft (3.40.030)
 - Push adapter shaft (3.40.030) into the coupling shaft (3.30.020)

3. Motor mounting / Fan mounting

- Remove plastic plug (3.40.050) if adapter shaft also (3.10.030) from assembly hole.
 - Place motor onto adapter housing. Ideally mount the motor in a vertical position to minimize unfavourable displacement.

Important: The motor shaft (3.40.090) must be introduced centrically into the adapter shaft (3.30.030). Do not introduce canted! If the motor shaft is not insertable untwist cheese-head screw (3.30.160) approx. a fourth turn against the pin to widen the hub (Fig. 4).

- Screw motor to adapter housing.
 - Tighten clamping screw (3.30.160) if adapter shaft also clamping screw (3.40.080) at the clamping ring. To do this, put the extension piece of the torque spanner through the assembly hole (B) (Fig. 3). Tightening torque M_A as per table.
 - Fasten the fan blade on the motor shaft or the adapter shaft. To do this, put the extension piece of the torque spanner through the ventilation slot on the motor side. Grub set screw

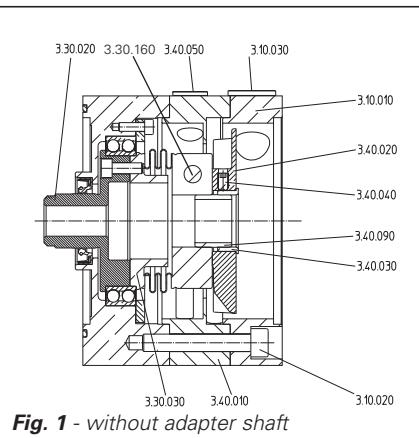


Fig. 1 - without adapter shaft

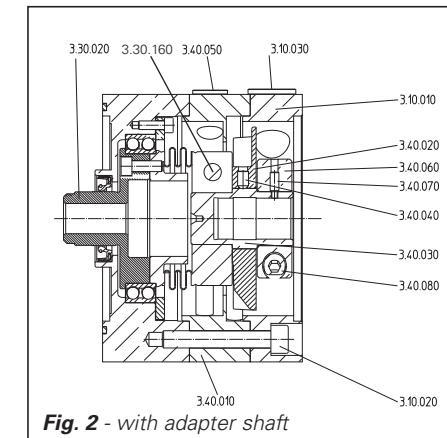


Fig. 2 - with adapter shaft

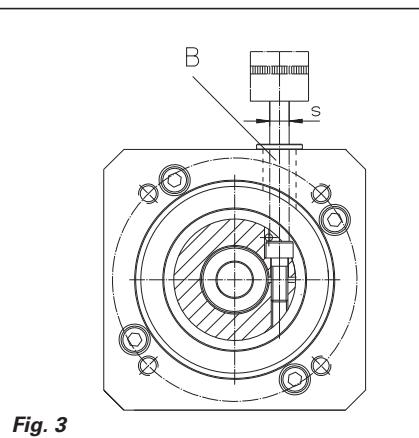


Fig. 3

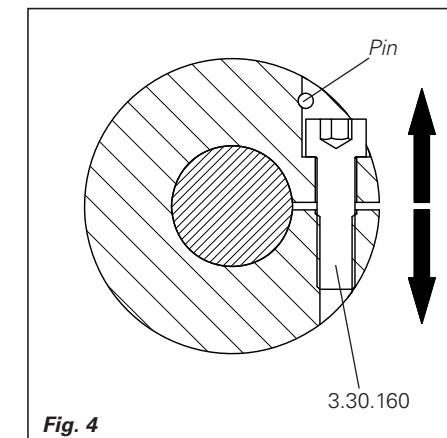


Fig. 4

| Tightening torque M_A | | | | |
|--|--|--------|----------------------|------------------------------|
| Gear Unit | Tighten Allen Screw / Fastening screw Position-No. | Thread | Wrench size "s" (mm) | Tightening torque M_A (Nm) |
| PA321MFCL, PHA321MFCL, PA421MFC, PHA421MFC , PA422MFCL, PHA422MFCL, PA522 MFC, PHA522MFC | 3.30.160 | M6 | 5 | 16 |
| | 3.40.040 | M4 | 2 | 1,5 |
| | 3.40.080 | M5 | 4 | 6 |
| | 3.10.020 | M6 | 5 | 10 |
| PA421MFCL, PHA421MFCL, PA521MFC, PHA521MFC, PA522MFCL, PHA522MFCL, PA722MFC, PHA722MFC | 3.30.160 | M8 | 6 | 40 |
| | 3.40.040 | M5 | 2,5 | 2 |
| | 3.40.080 | M6 | 5 | 10 |
| | 3.10.020 | M8 | 6 | 25 |
| PA521MFCL, PHA521MFCL, PA721MFC, PHA721MFC, PA722MFCL, PHA722MFCL, PA822MFC, PHA822MFC, PHA923MFC,PHVA933MFC | 3.30.160 | M10 | 8 | 75 |
| | 3.40.040 | M8 | 4 | 5 |
| | 3.40.080 | M8 | 6 | 25 |
| | 3.10.020 | M10 | 8 | 49 |
| PA721MFCL, PHA721MFCL, PA821MFC, PHA821MFC, PA822MFCL, PHA822MFCL, PHA912MFC, PHA932MFC, PHA1012MFC, PHA1023MFC, PHA1032MFC, PHVA1033MFC | 3.30.160 | M12 | 10 | 130 |
| | 3.40.040 | M8 | 4 | 5 |
| | 3.40.080 | M8 | 6 | 25 |
| | 3.10.020 | M12 | 10 | 85 |

(3.40.040) 3 x tightening torque M_A as per table.

- Reclose assembly hole with plastic plug (3.40.050) respectively (3.10.030).